



FAG

Service Info



Installation instruction FAG 201050

Inspecting the protective ring behind the wheel hub

Manufacturer: Mercedes-Benz

Models: Actros MP2 / MP3
Atego / Atego 2 / Atego 3
Axor 2

Part no.: 201050

For current listing refer to catalogue media

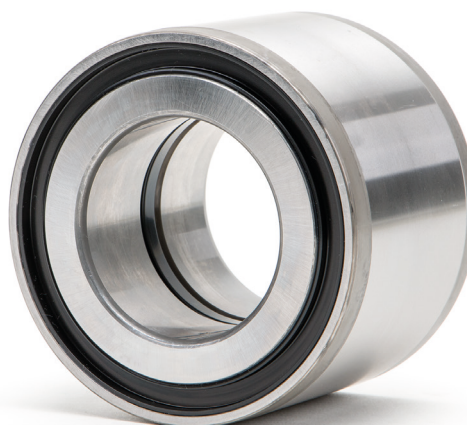


Fig 1: FAG Wheel Bearing 201050

For the specified vehicles, the wheel bearing on the front axle is only available as a complete unit from the vehicle manufacturer (wheel hub with integrated wheel bearing).

However, as it is only the wheel bearing that is faulty in most cases of damage, it is only the wheel bearing that actually needs to be replaced. The wheel hub can be used again.

Schaeffler Automotive Aftermarket is therefore offering a wheel bearing kit under part number 201050.

If, while performing the repair, the protective ring behind the wheel hub is found to be defective, it must be replaced. It can be ordered only from the manufacturer of the vehicle.

For correct part selection, note that there are three different variants: In order to identify the appropriate protective ring, the diameter of the seal seat must be measured (Fig. 2).



Fig. 2: In order to determine which of the three protective rings will fit, the diameter of the seal seat must be measured

Diameter measured	Protective ring required
86,70 to 86,85 mm	Protective ring with no coloured marking
86,85 to 87,05 mm	Protective ring with red marking
87,05 to 87,30 mm	Protective ring with white marking

Please observe the vehicle manufacturer specifications!

You want more? We can help!

Phone: +44 (0) 1432 264 264*

Fax: +44 (0) 1432 375 760

hfd-info@schaeffler.com

www.schaeffler-aftermarket.co.uk

* Calls from within the UK 08457 001100

